BOREWELL COMPLETION REPORT

VINAYAKA ENTERPRISES

Borewell Drilling Contractors

Mobile : +91 9342202932 / 9343202932

No. 9, Bhadrappa Layout, Bhadrappa Compound, Near Hebbal, Ring Road, Bangalore 560094

No. : 1172

Date : 06-07-2023

1. Customer's Name and Address : Assistant Executive Engineer
   with Telephone No. Vidyaranyapura Sub Division
   BBMP Banglore-97.

2. Well Location : D.B Scendre KK Compound RR School Road

3. Total Well Depth / Drilled in Ft. : 990 Ft

4. Casing Erected in Ft. : 200 Ft

5. Water Struck at the Depth of : 860 Ft

6. Total Yield (Measuring method "V" Norch : 2½" / Inches on "V" Norch)

7. Formation of Soil/Well Water Condition : Boulders/Silt/Loose Soil/Clear ✓

8. At the Depth of : 860 Ft

9. Recommended to use Jet Pump / Air Compressor / Submersible ✓ /Hand Pump

The Borewell was drilled in accordance with the company terms and conditions and handed over to customer in good/ satisfied / Party agreed conditions.

Once the well handed over to party, company is no way responsible for further developments if anything in the well or what so ever.

Party's Signature

I, owner of the Well / (Authorised signatory) fully understood the terms and conditions and the well completion report, I also fully understood the quality and quantity of water from the well duly depend upon the nature / formation of ground water and the drilling agency no way responsible for further occurrence / Changes in the bore with full satisfaction. I hereby endorse my signature.

For VINAYAKA ENTERPRISES

Party's Signature

AE-13

~~Manager~~ / Proprietor

Bhustalimath B M (Basavaraj) Consultant in Groundwater & Water Harvesting
B Sc., B Ed, DIRPM, U. B(Spl), CAIIB, MBA

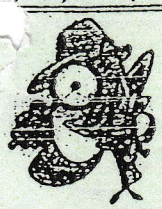

A WORD ABOUT GROUNDWATER INVESTIGATION

Dear Borewell seekers,

Water is the second important requirement for life on earth, next to air. Of the available water on land, about 30% is groundwater, hidden under the soil, flowing through streams and accumulating in the aquifers, as per its property of maintaining its level and flowing from higher level to lower level.

Geologists and diviners adopt their professional methods to investigate these hidden sources of water and claim success of their investigations in terms of the results. They have no business in places where groundwater is available everywhere (like river-beds) and no groundwater everywhere (like deserts and mountain rock-top). Their profession works in places in between the two.

Nature gives certain clues of existence of groundwater: (1) The annual rainfall in the area; (2) The catchment area; (3) The density of trees in the locality; (4) The nearby water-bodies (like rivers, canals, lakes, tanks); (5) The aquifer (water-holding and transmitting underground rocks) characteristics.

The olden colonial systems preferred north-east direction for water as auspicious. The same is expected in the modern urban systems, where the land/plot-boundaries are human manifestations. But the probability of getting water in the north-east quadrant of the plot is 25%. And all time and days are auspicious for groundwater investigation or drilling a borewell.

There are rarest chances (less than 1/2 percent) of striking less water or no water at the investigated point due to (1) obstructions/distractions by earth-formations, (2) rock-edging(skidding) to the drill-bit/head, (3) bent drilling rods, (4) upstream puncture/s and stoppage/diversion of the streams, (5) stream flowing down lower dry holes due to excessive drillings than necessary and (6) outcrops in the streams(7) Harder rocks, (8) mud-collapse, and the like. Most issues have solutions. If a drill bypasses a stream, it can be addressed by gelatin-blasting at the right depth by video-profiling of the borehole (under expert supervision as to the secondary risks). The silt and boulders can be arrested by using standard hard filter-casing/s. Water is to be taken out from borehole at least for 3 minutes in a day and to be flushed for every two years or whenever the yield reduces, if there are sedimentary particles in the water. It is better to get the water chemically tested before use for lead, arsenic, fluorides, hardness, total dissolved salts (TDS), pH, etc.

A dried/failed bore well can restart or can be revived or can best be used for rainwater harvesting.

You are welcome for all issues related to groundwater by phone/SMS/emails.

Enjoy the nature's invaluable free gift justly and fairly sharing with others.

With warm regards and serving for your success,

Bhustalimath Basavaraj M, Groundwater consultant, Bangalore

#95, TF-1, Adishree Appt, Near Krishna Temple, Doddabommasandra, Vidyaranyapura,Bangalore 560097
Ph: [redacted] Mob: 91 9538909542/[redacted] mail: bmbmath@gmail.com/[redacted]

AE-12

Bhustalimath B M (Basavaraj)
B Sc, B Ed, DIRPM, LL B(Spl), CAIIB, MBA

Consultant in Groundwater investigation & Water Harvesting

REPORT ON GROUNDWATER INVESTIGATION/SURVEY

Ref by_____ Contact: Person_____

Owner:_____

_____

Address of the site:_____

_____

Purpose of Survey: Agri/Resi/Domestic/Coml/Indl/Public Utility/Buying & Selling of lands/RE.

Type: Hydrological survey/ second opinion/ Failed or weak Borewell/_____

Location: (Latitude/longitude): North: ..... East: ..... (N.A)

Soil: Sandy/Loamy/Clayey/ .....Red/ Black/.....

Topography:_____

Groundwater recharge condition: Excellent/Very good/Moderate/Poor/Very poor/.....

Date of Investigation:_____ Validity:_____

Methods adopted: (1)'L' Rods(✓)(2) Copper wand (✓)(3) Coconut ( )(4) Brunton compass(✓)
(5)'Y' notch ( ) (6) Pendulum/Bob/Chain/Necklace/Wrist watch/Water ball/Mud ball (✓)
(7) Geomagnetic flux ( ) (8) Infrasonics ( ) (9) Geobiology( ) (10) Topography/Geomorphology
( ) (11) Vertical Electrical Sounding/Resistivity (VES/VER) ( )(12) Water Detector( )
(13) Water scanner ( ) (14) ..... ( )

Based on above findings/investigations/observations, the following suggestions are made.

Depth to be drilled: About_____ Mtrs/Ft, Casing Pipe:_____Mtr/Ft (MS/PVC/Out/In)

Depth to water source/s:About_____Mtr/Ft(stream/aquifer/)

Approx total yield of water: About_____Inch dia or About _____ Ltrs/Gal(=4.5 L)per hour.

Diameter of the borewell in inches suggested: 4 ½( ) 6( ) 6½(✓) 7( ) 7½( ) 8( ) 10( )

Special instructions: (a) Align the driller on the streamline; (b) perfect 90 degree drilling.

Brief Map/Identification of Point/s: (Paper-top presumed to be north, right side as east)

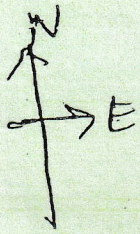

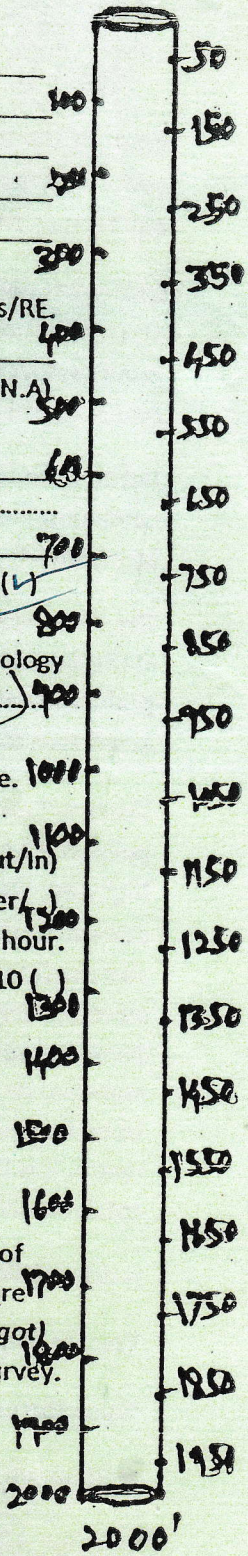

Disclaimer: The above depths and yield are indicative, based on the findings at the time of investigation. There is no guarantee as to depths and discharge of water, as the results are beyond our control. Jurisdiction: Bangalore city. *(Tips: Yield= 2600 X Square of inches got)*

Please pay/Received Rs.....(Rs.....)towards this groundwater investigation/survey.

Place: Bangalore
Date: 22/06/23

Bhustalimath B M
Groundwater & Water Harvesting Consultant

Mobiles - 9538909542 & 9902498502 OR 7411008937

#95, TF-1, Adishree Aptt, Nr Krishna temple, DBSandra, Vidyaranyapura Po, Bangalore-560097 (India)
Cell: ~~+9221~~9538909542 Resi; ~~[redacted]~~, Mail: bmbmath@gmail.com & ~~[redacted]~~

9902 498 502
C - Casing
I - Inner
O - outer
S - Stream M - Motor (Submersible)/Pump
A - Aquifer W - Water level.

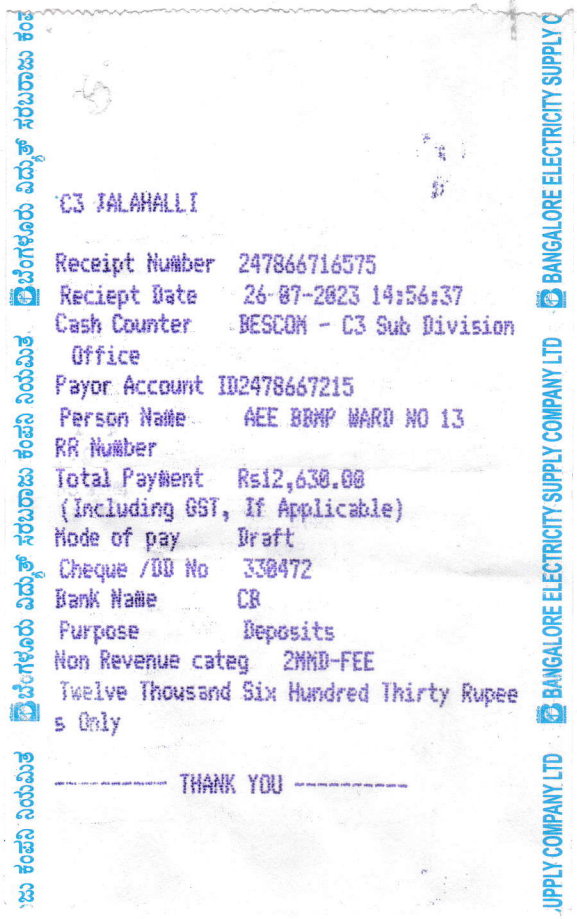

C3 JALAHALLI

Receipt Number 247866716575
Reciept Date 26-07-2023 14:56:37
Cash Counter BESCOM - C3 Sub Division Office
Payor Account ID2478667215
Person Name AEE BBMP WARD NO 13
RR Number
Total Payment Rs12,630.00
(Including GST, If Applicable)
Mode of pay Draft
Cheque /DD No 330472
Bank Name CB
Purpose Deposits
Non Revenue categ 2NND-FEE
Twelve Thousand Six Hundred Thirty Rupees Only

---------- THANK YOU ----------

C3 JALAHALLI

Receipt Number 247866797103
Reciept Date 21-07-2023 11:52:47
Cash Counter BESCOM - C3 Sub Division Office
Payor Account ID2478667215
Person Name AEE BBMP WARD NO 13
RR Number
Total Payment Rs118.00
(Including GST, If Applicable)
Mode of pay Cash
Purpose Non Revenue
Non Revenue categ REG-FEE
One Hundred and Eighteen Rupees Only

---------- THANK YOU ----------

Tax Invoice

Genus
energizing lives

GENUS POWER INFRASTRUCTURES LIMITED
Corporation No 13, B.R.V. Layout, Postal No 24, Palace Guttahalli, Kumar Park West, Bengaluru Urban, Karnataka, 560020
GSTIN/UIN: 29AACCG1218P1ZD
State Name : Karnataka, Code : 29
CIN: L51909UP1992PLC051997

Invoice No.	Dated
12002987	**2-Aug-23**
Delivery Note	Mode/Terms of Payment
WO G9287 C3	
Reference No. & Date.	Other References
Buyer's Order No.	Dated
Dispatch Doc No.	Delivery Note Date
	31-Jul-23
Dispatched through	Destination
Terms of Delivery	

Buyer (Bill to)

AEE BBMP WARD NO13
D B SANDRA RR SCHOOL ROAD BLR
State Name : Karnataka, Code : 29

Sl No.	Description of Goods	HSN/SAC	Quantity	Rate	per	Amount
1	**Raj-3P,4W,5-30A,240V,1101(BESCOM) GB94B** *3406564*	90283010	**1 Nos**	2,059.32	Nos	**2,059.32**
	CGST					**185.34**
	SGST					**185.34**
	Total		**1 Nos**			**₹ 2,430.00**

E. & O.E

Amount Chargeable (in words)

INR Two Thousand Four Hundred Thirty Only

HSN/SAC	Taxable Value	Central Tax Rate	Central Tax Amount	State Tax Rate	State Tax Amount	Total Tax Amount
90283010	2,059.32	9%	185.34	9%	185.34	370.68
Total	**2,059.32**		**185.34**		**185.34**	**370.68**

Tax Amount (in words) : **INR Three Hundred Seventy and Sixty Eight paise Only**

Declaration
We declare that this invoice shows the actual price of the goods described and that all particulars are true and correct.

for GENUS POWER INFRASTRUCTURES LIMITED

Authorised Signatory

This is a Computer Generated Invoice

0 12630/-
118/-
2430/-
15178/-